


## Disassembly:

Preview installation instructions before disassembly. Use heat gun to heat the screws that need to be fixed with glue before disassembly.





Heat gun

Please remove the following parts as a whole:

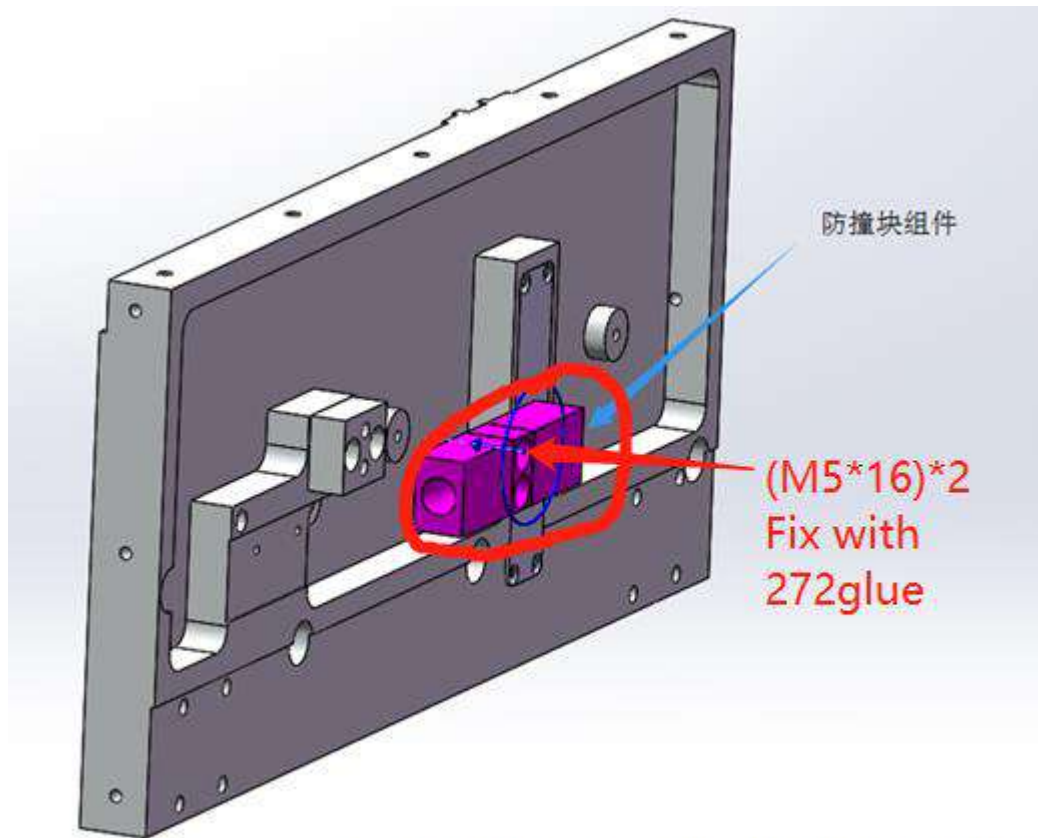

把组装好的防撞块组件，采用2颗M5\*16镀锌内六角圆柱螺钉固定在TK3S拖板上，并打上乐泰272螺纹胶水

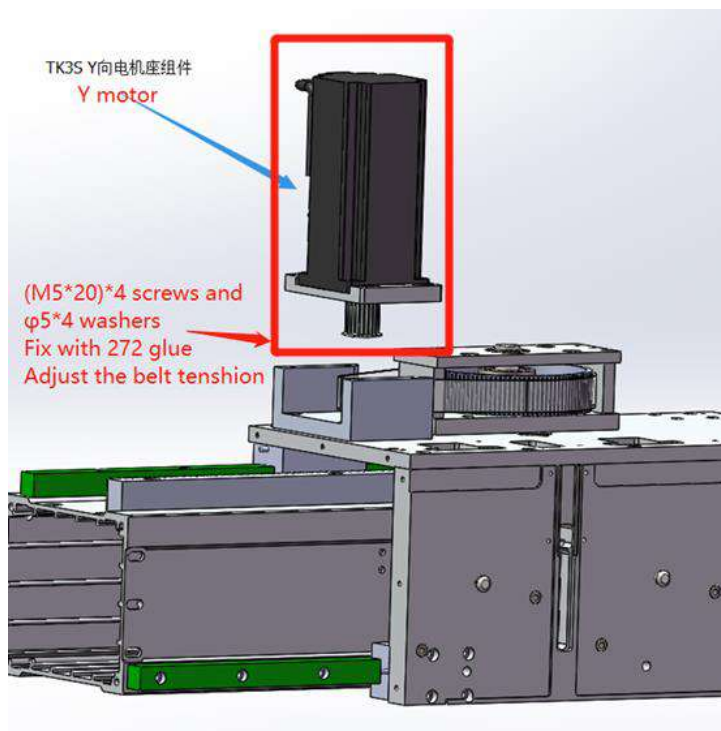

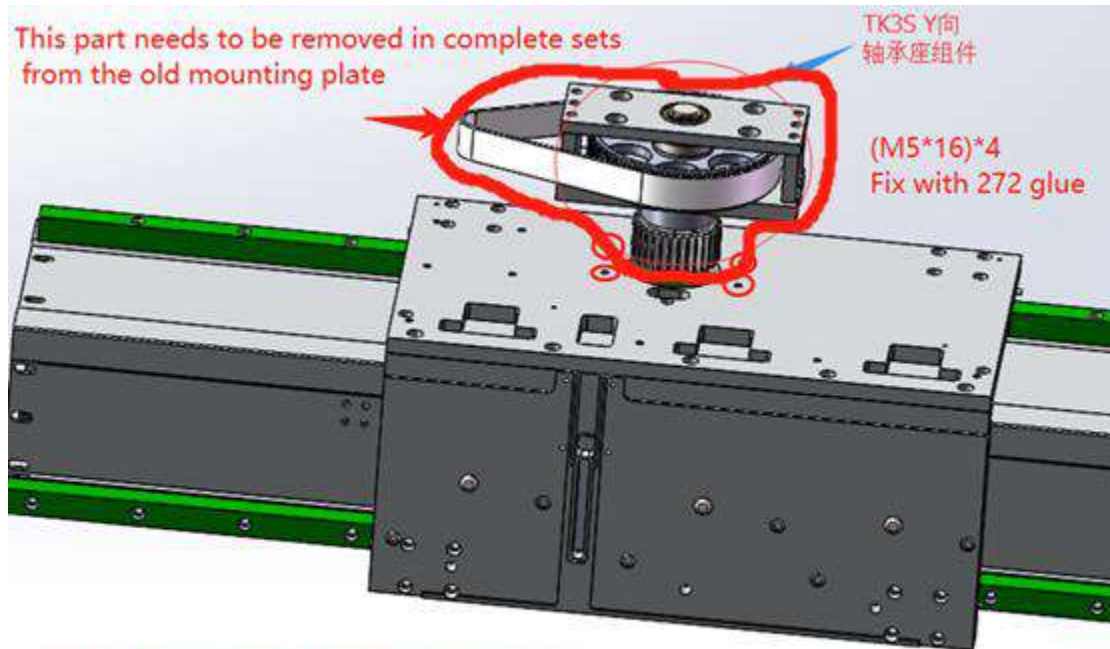

按图中所示把TK3S Y向轴承座组件安装TK3S拖板平上  
采用4颗M5\*16镀锌内六角圆柱螺钉固定。

## Installation:

Please follow the instructions to use the correct screws for installation







Please follow the instructions to use the glue correctly





Loctite 272 glue

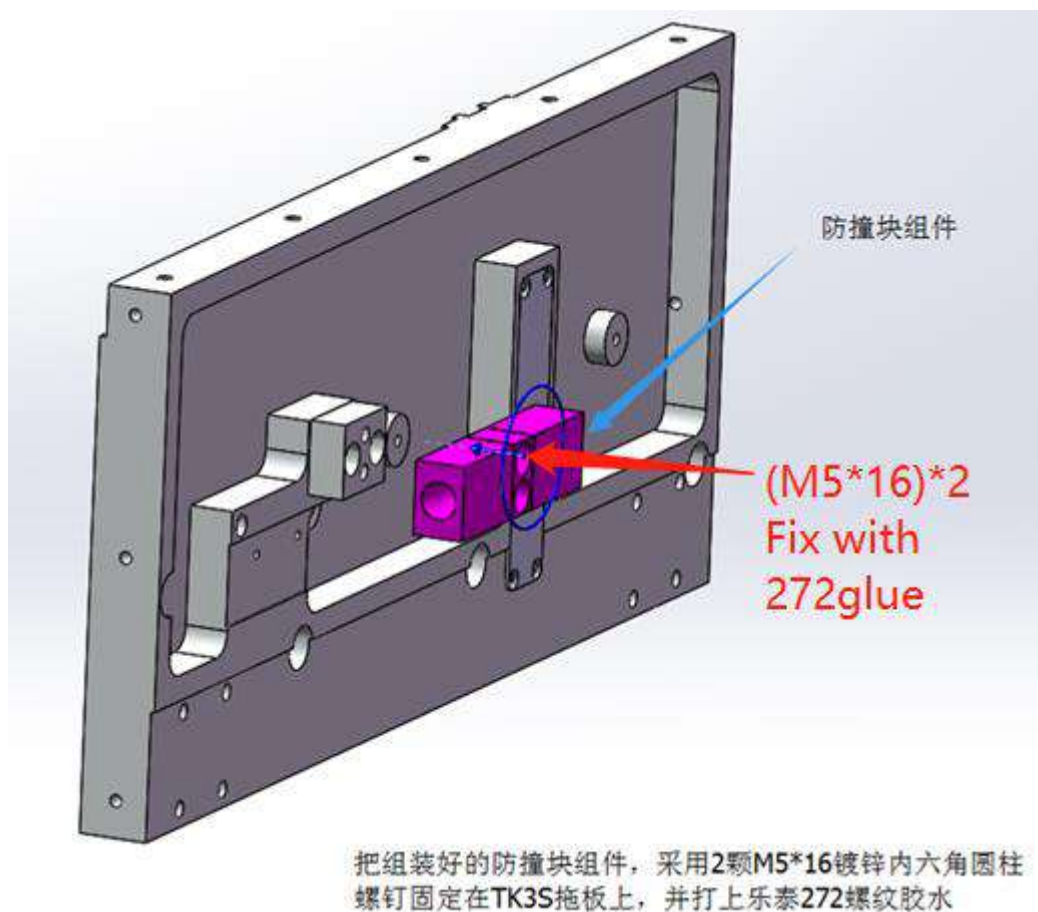


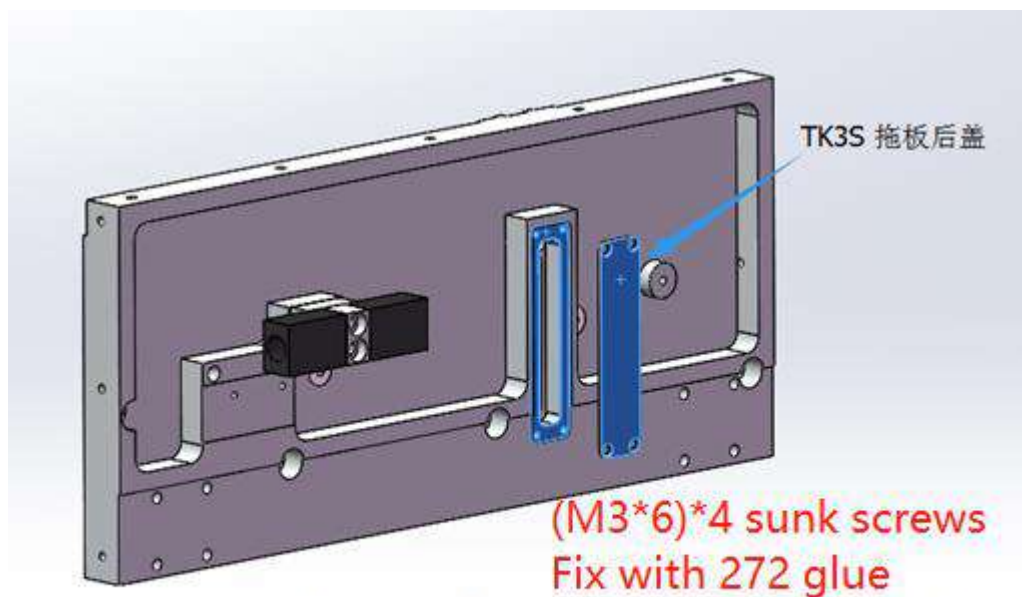

按图中所示，把TK3S拖板后盖用4颗M3\*6镀锌内六角沉头螺栓固定在TK3S拖板上，打上乐泰272螺纹胶固定。

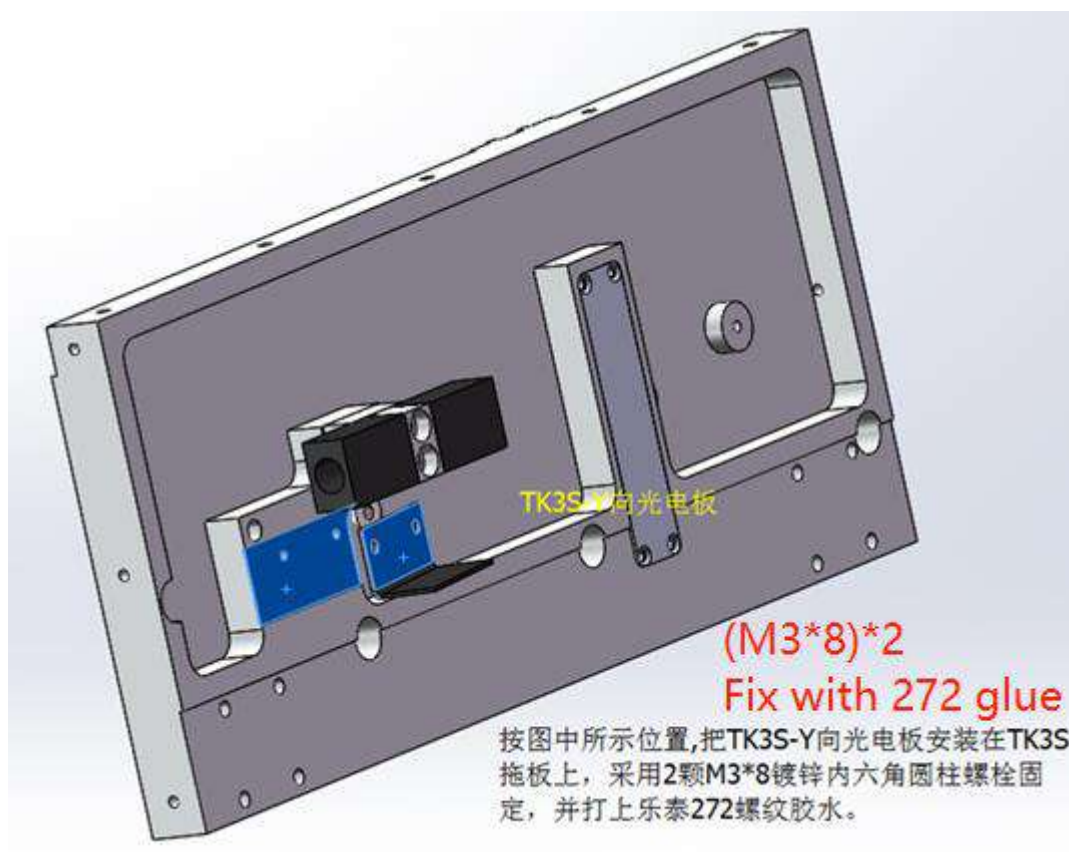

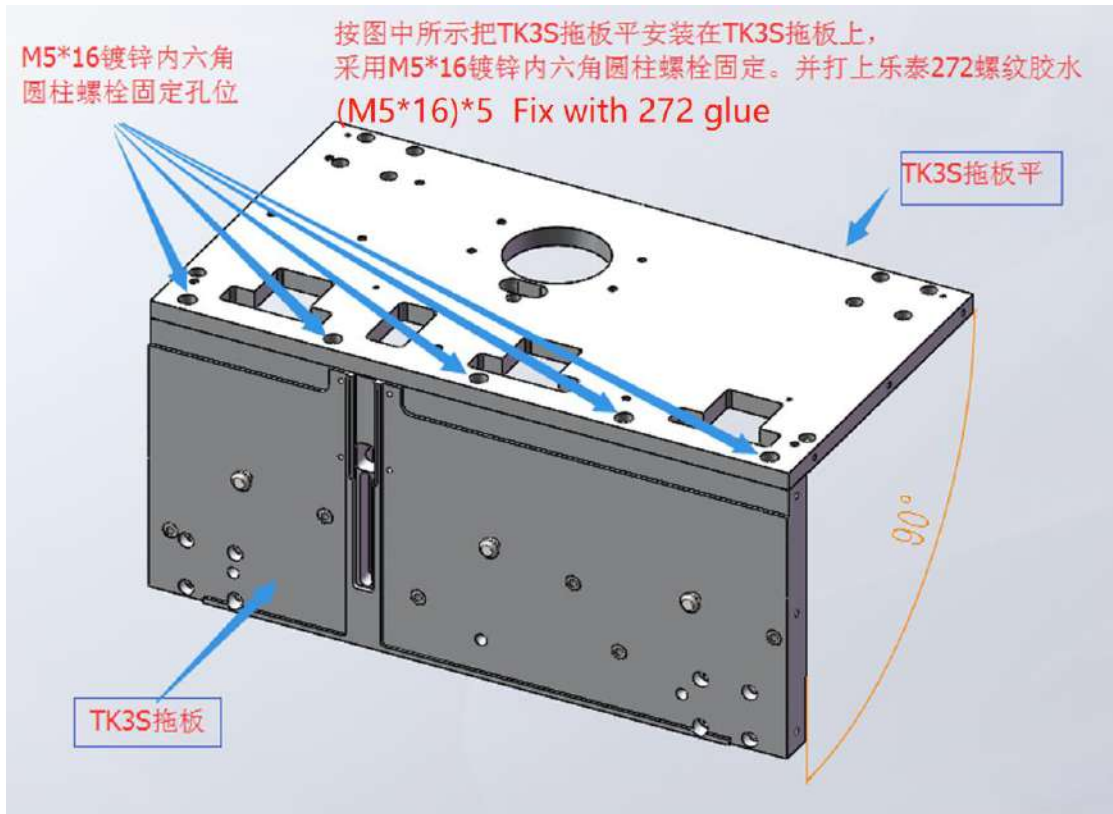

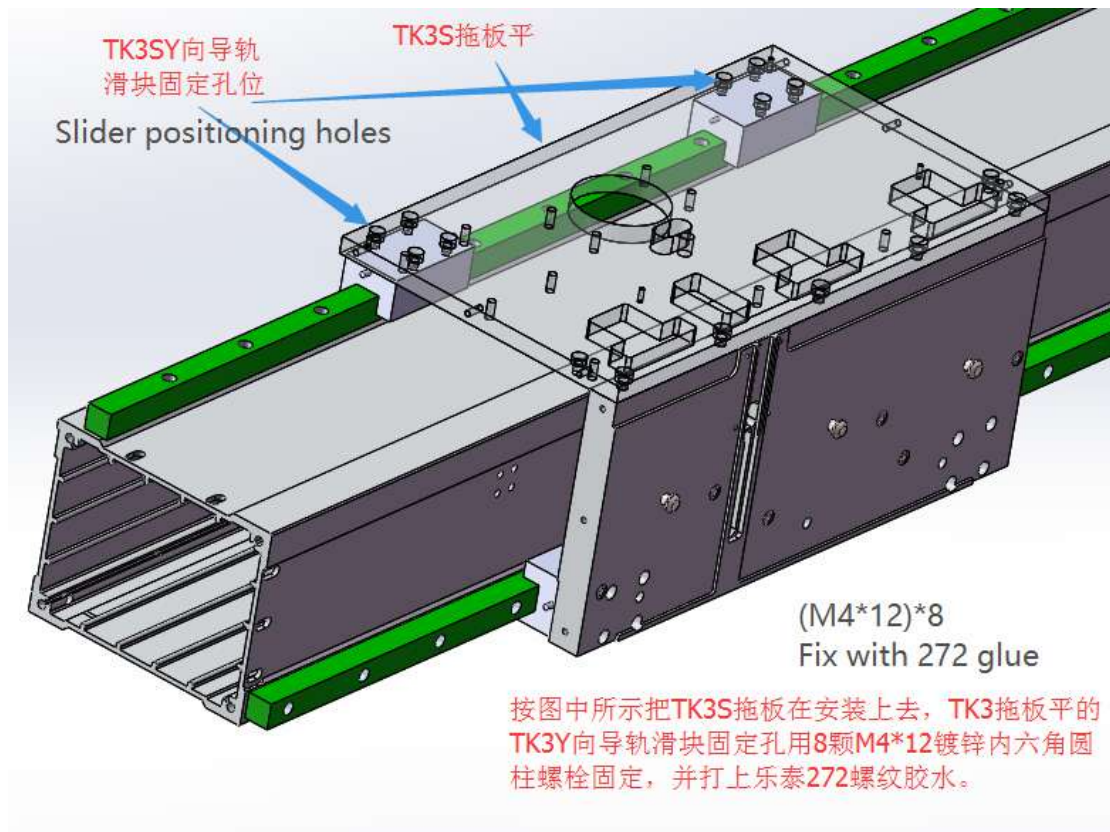





TK3S Y向电机连接板


采用4颗M5\*12镀锌内六角圆柱螺钉固定，并打上乐泰272螺纹胶水，注意TK3S Y向电机连接板的安装方向

(M5\*12)\*4  
Fix with 272 glue

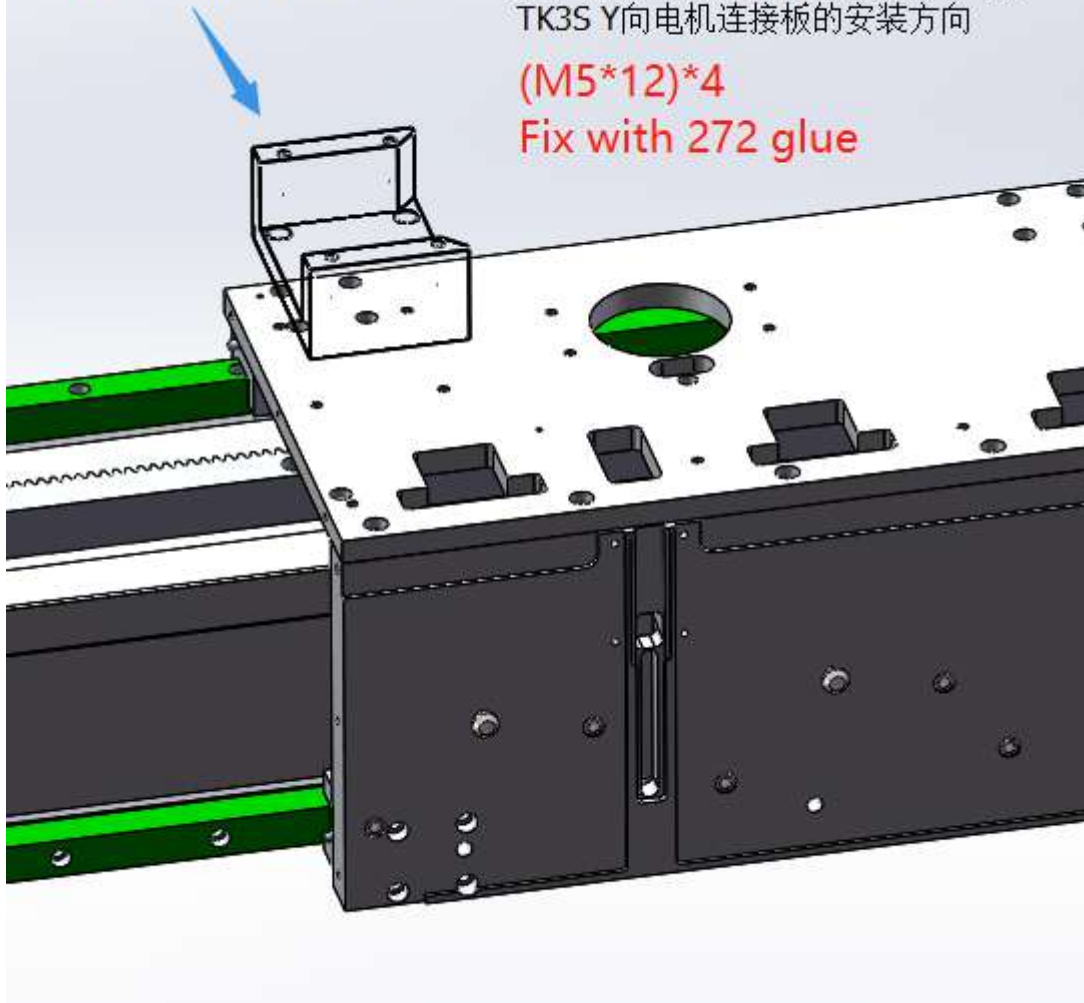

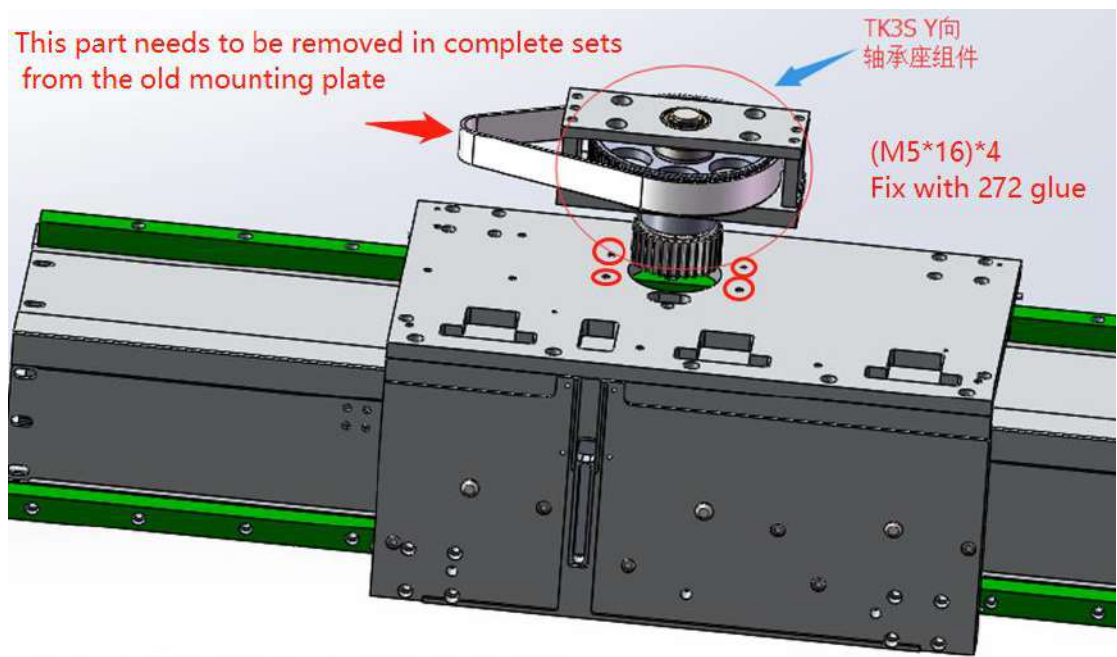


按图中所示把TK3S Y向轴承座组件安装TK3S拖板上  
采用4颗M5\*16镀锌内六角圆柱螺钉固定。

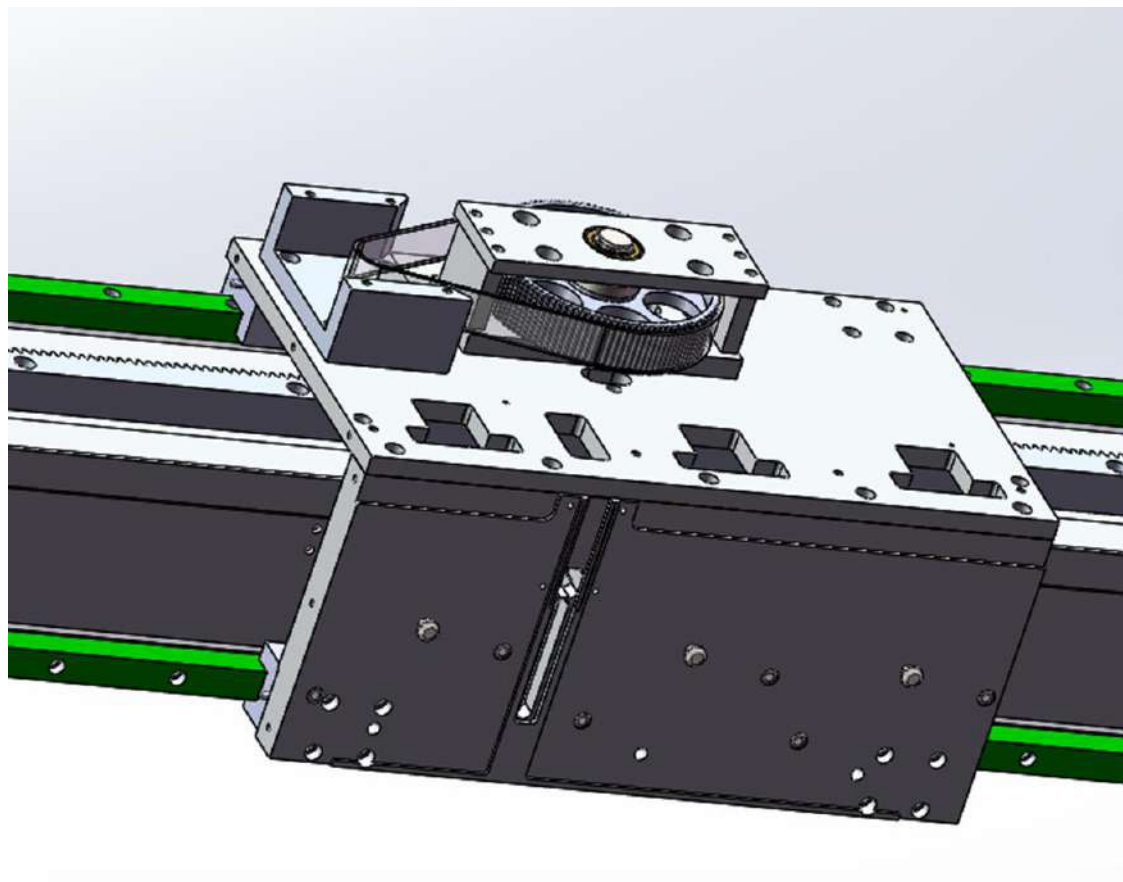


TK3S Y向电机座组件

Y motor


(M5\*20)\*4 screws and  
 $\phi 5*4$  washers  
Fix with 272 glue  
Adjust the belt tension


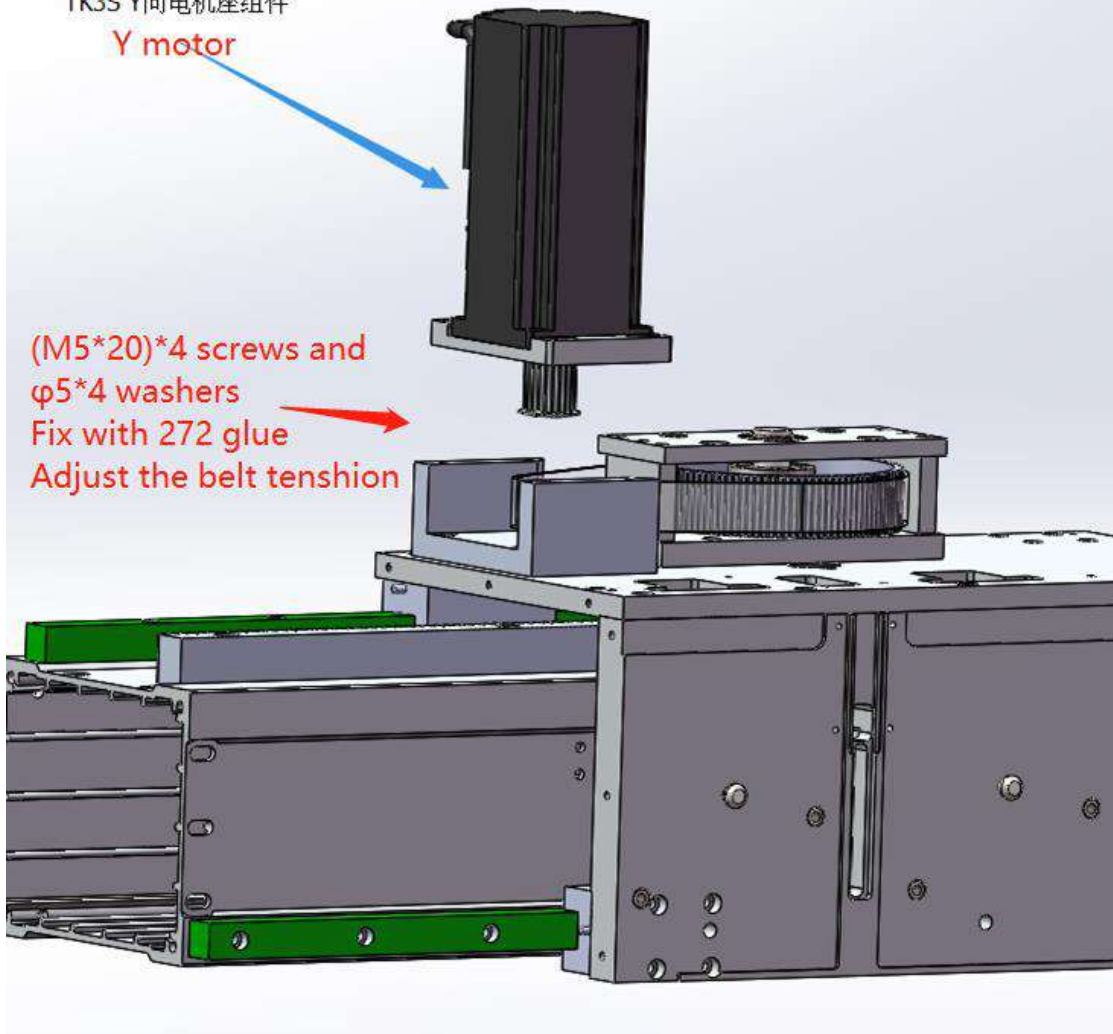


Cable protection box  
TK3S Y向包线盒

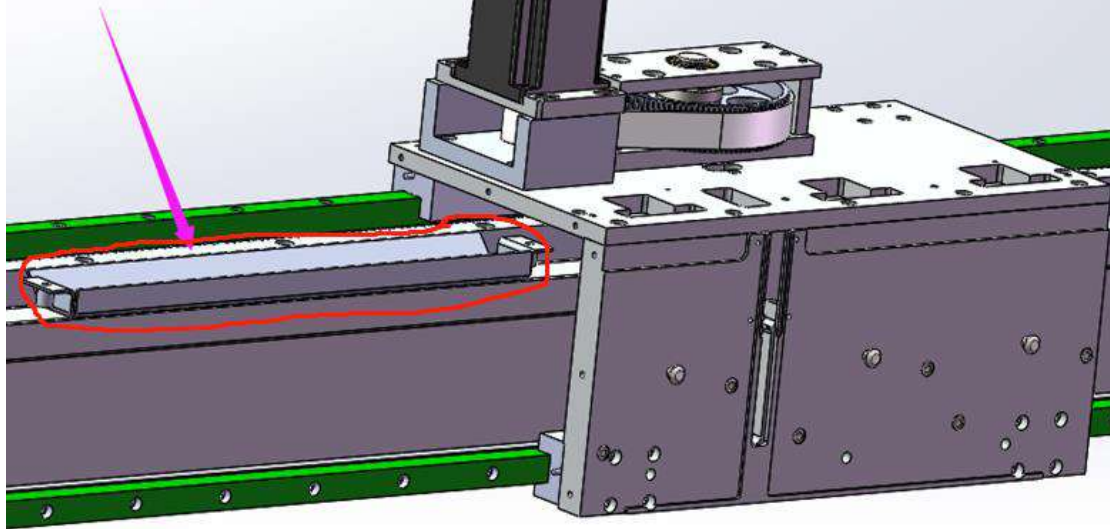


按图中所示把TK3S Y向包线盒按在TK3S拖板上采用M4\*16镀锌内六角圆柱螺栓固定，打上乐泰272螺纹胶水  
(M4\*16)\*2 Fix with 272 glue

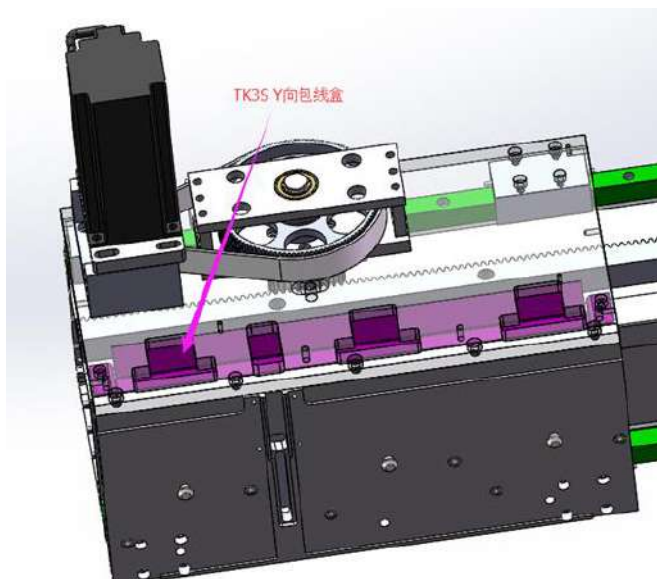

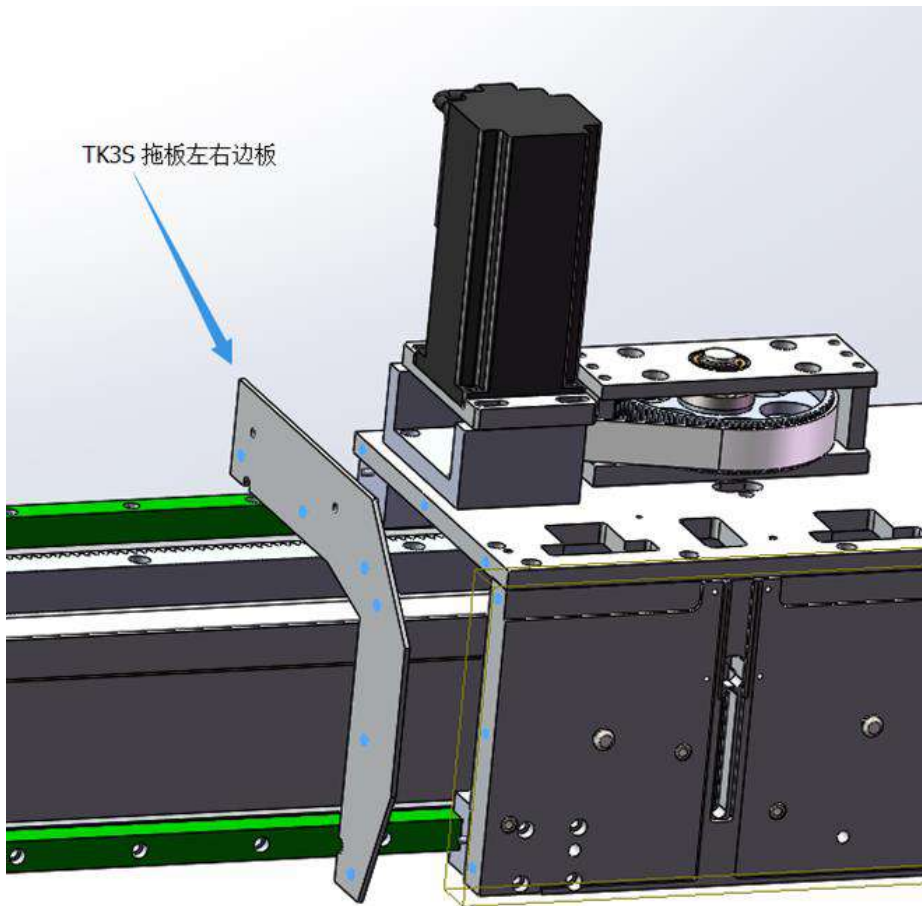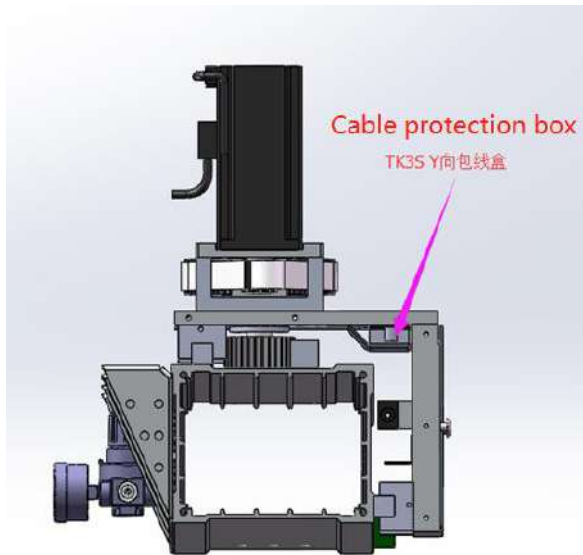


按图中所示把TK35 拖板左右边板安装图中所示位置，采用6颗M4\*12镀锌内六角圆头螺钉固定，打上乐泰272螺纹胶水


**(M4\*12)\*6 Round head screws . Fix with 272 glue**

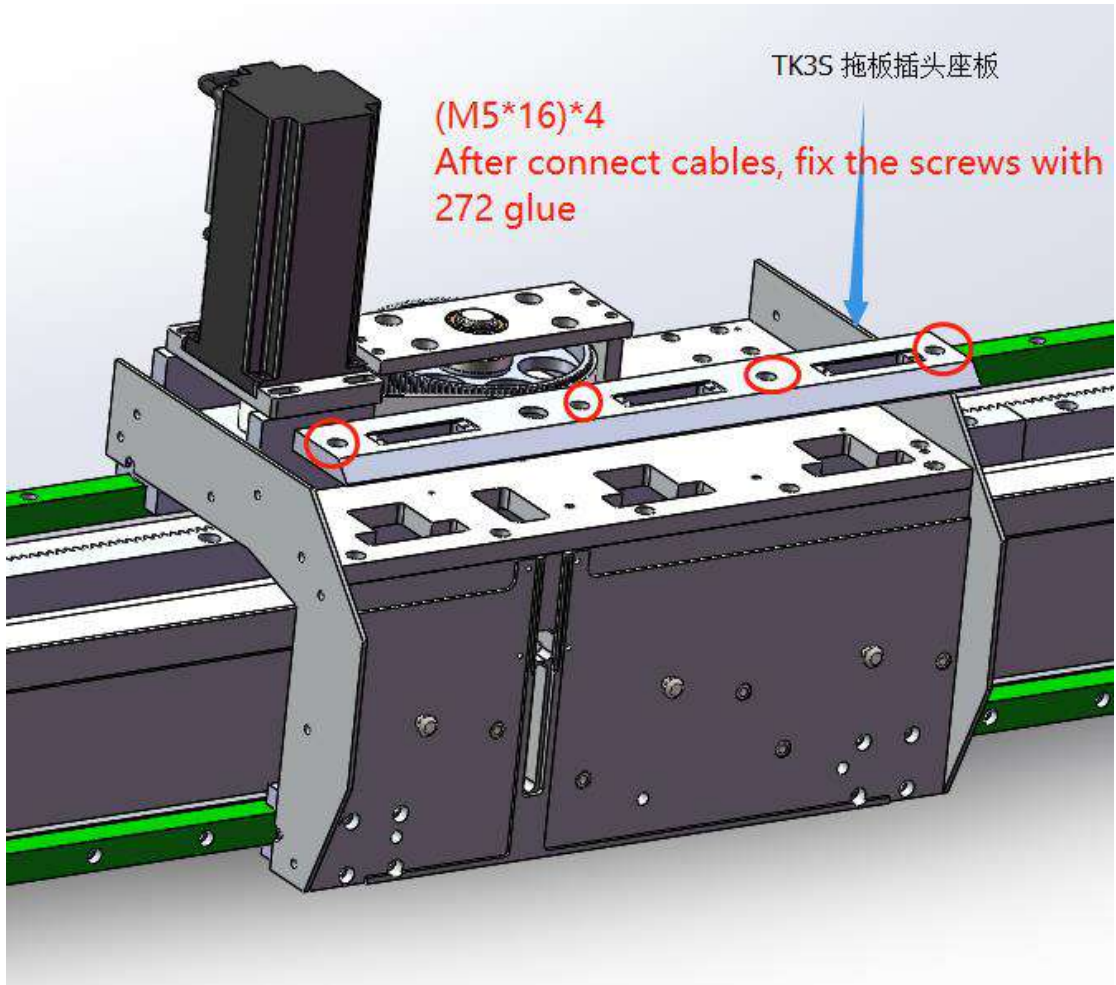

按图所示把TK3S拖板罩安装在TK3S拖链边板上，采用4颗M4\*12镀锌内六角圆柱螺钉固定，打上乐泰272螺纹胶水固定。

(M4\*12)\*4 Fix with 272 glue

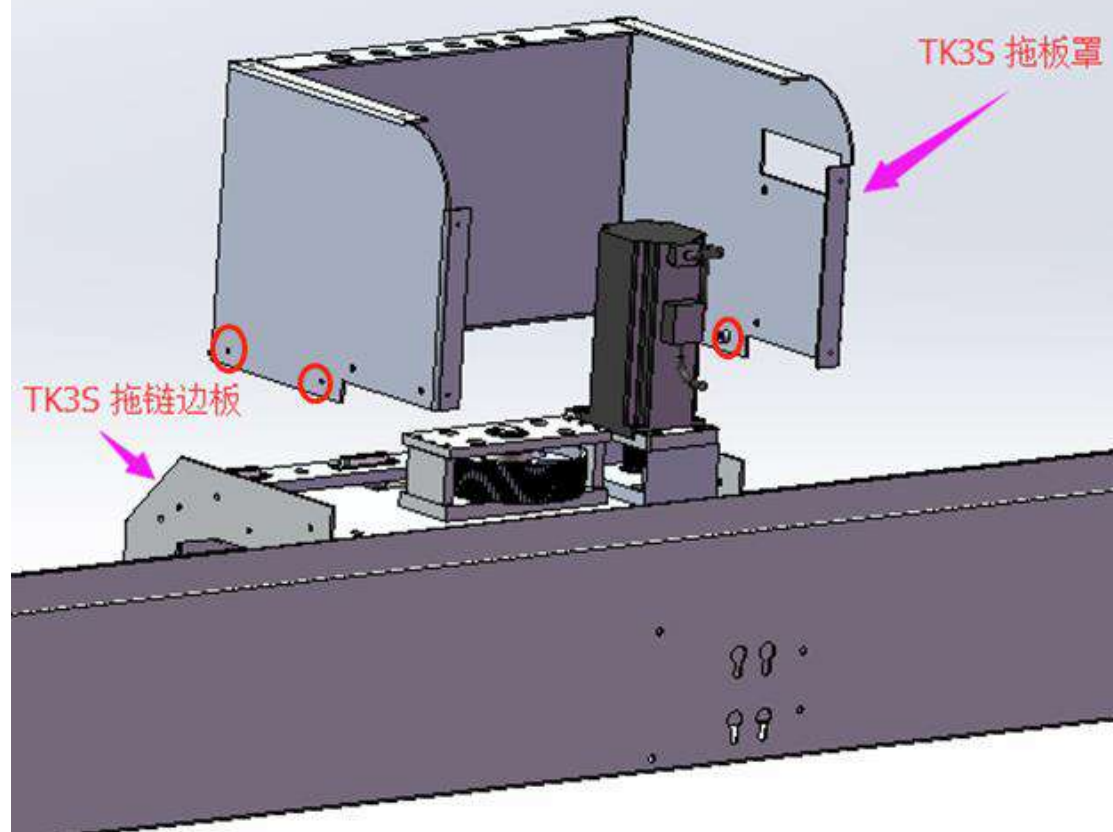

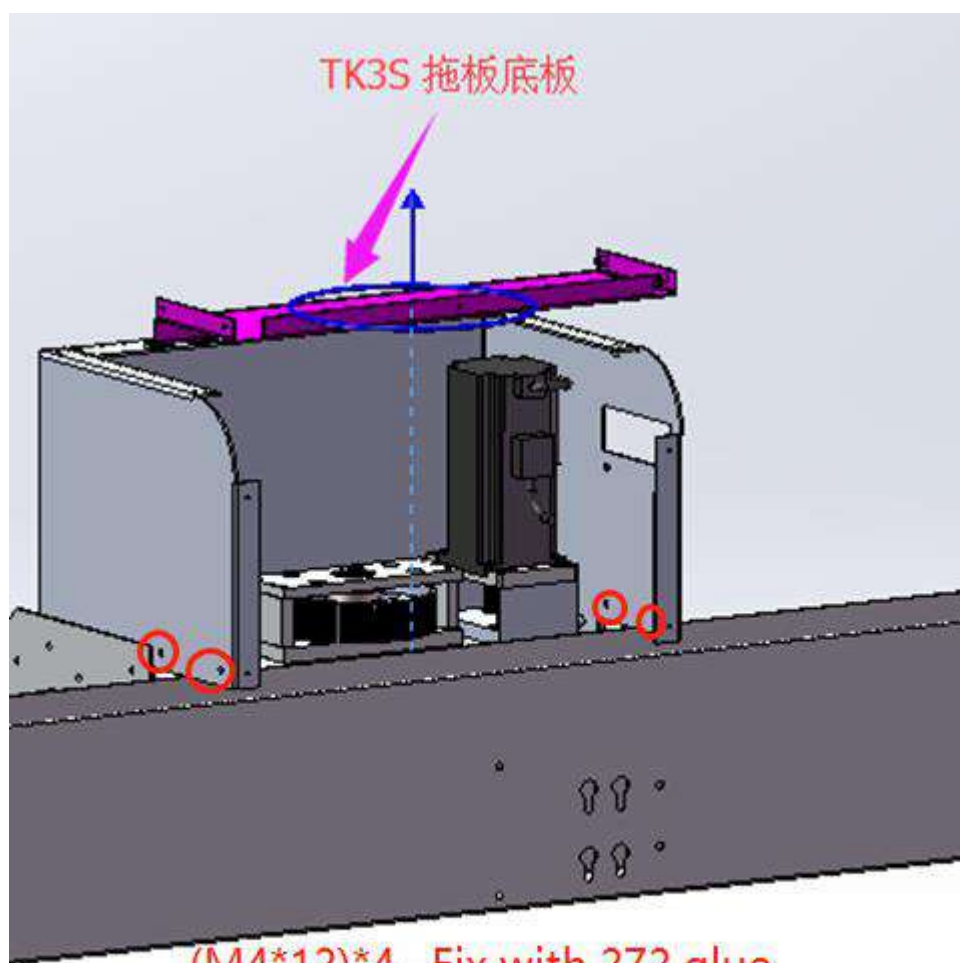


**(M4\*12)\*4 Fix with 272 glue**


按图所示把TK3S 拖板底板安装在TK3S 拖板罩上，采用4颗M4\*12镀锌内六角圆杯螺钉固定，打上乐泰272螺纹胶水。



按图中所示，把TK3S Y向B板安装板安装在TK3S拖板平上，采用4颗M3\*6镀锌内六角圆柱螺钉，打上乐泰272螺纹胶水

**(M3\*6)\*4 Fix with 272 glue**

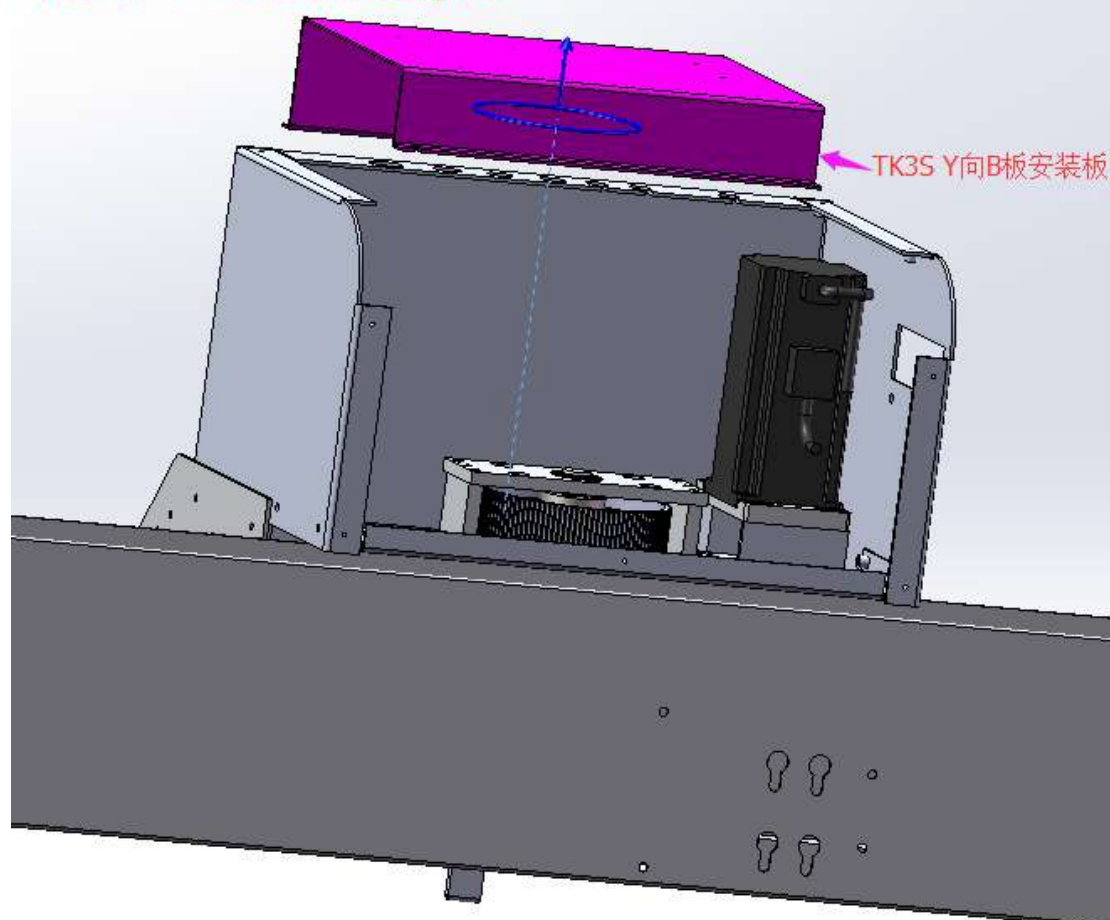

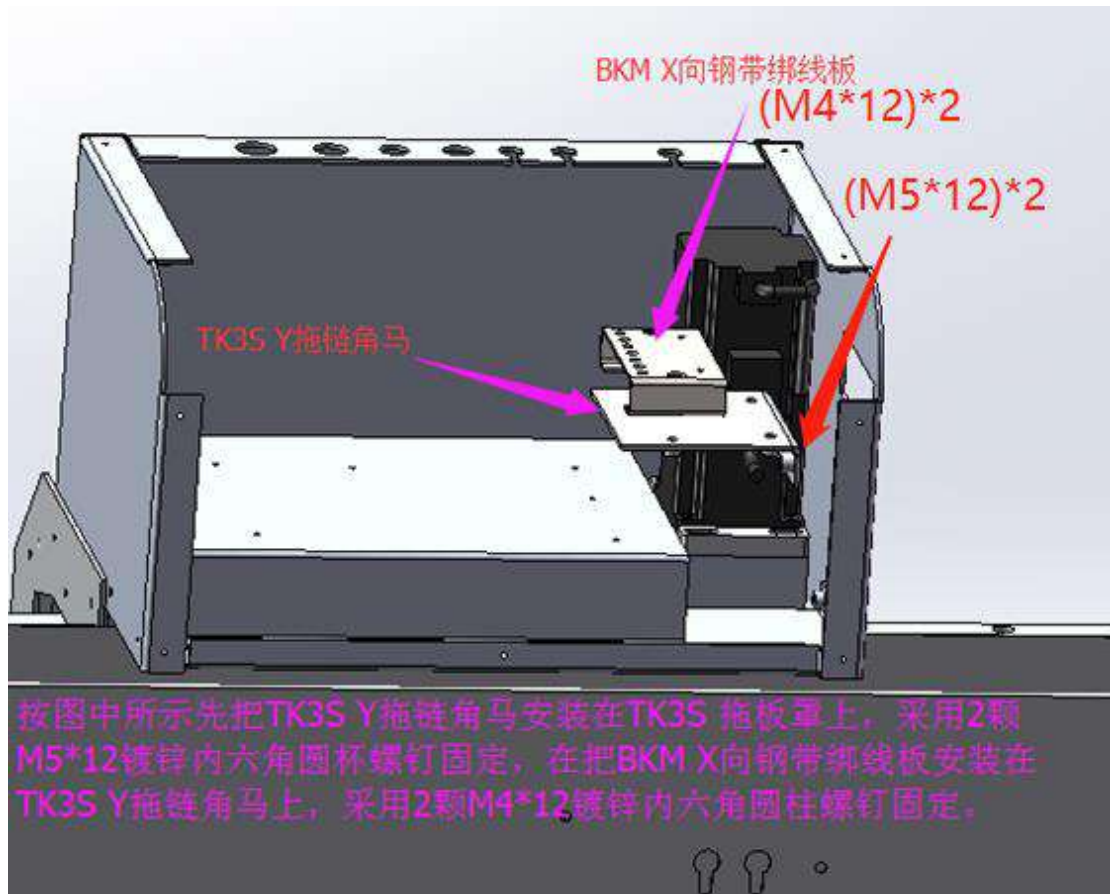

After the installation is completed, wait for 24 hours for the glue to solidify before machine powered on.

## Cable connection:

1. Remove safety device



Take off the safety device and unplug the connector



2. Remove other covers




3. Connect flat cable from epos board to driver.

Connect power cable from L,N,PE connector to driver.




TK4S-Three head drive220VPower cable TK4S05D

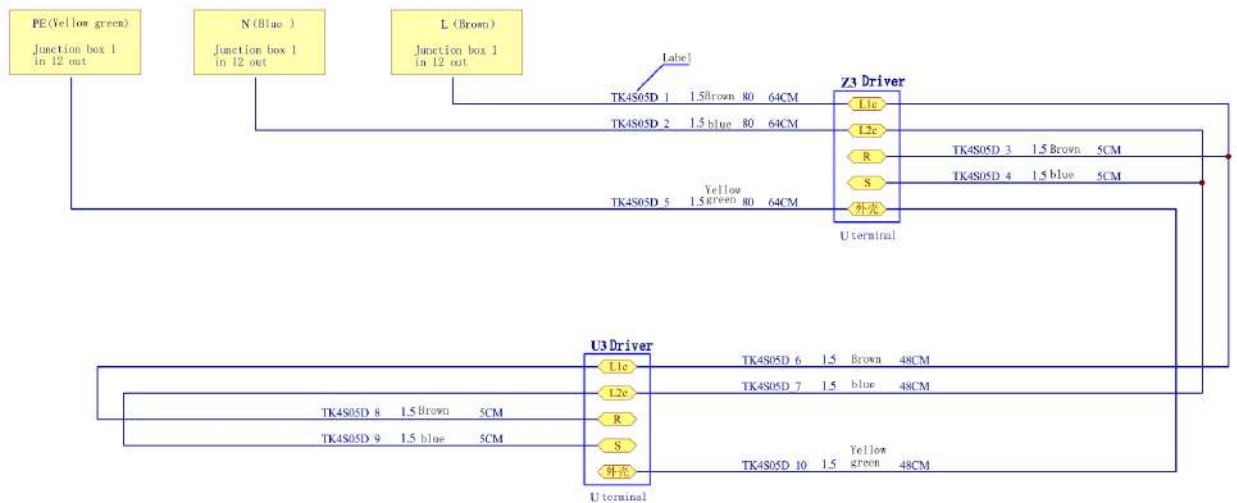

4. Connect encoder cable and power cable on driver.




**X drag chain parts**

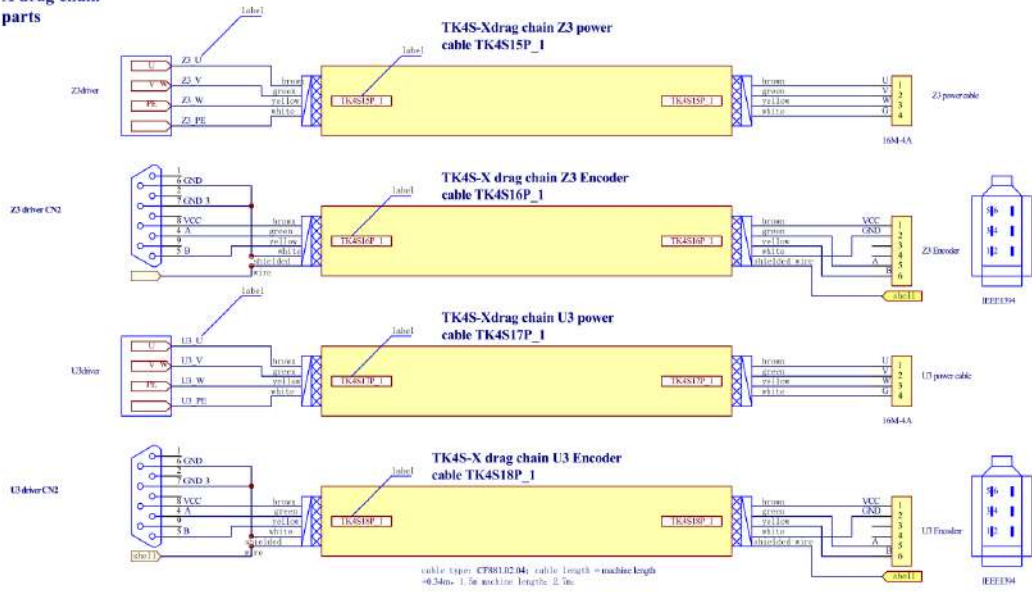

**TK4S-circuit diagram of cutting head3 X cable V1.0.1**

**Y drag chain parts**

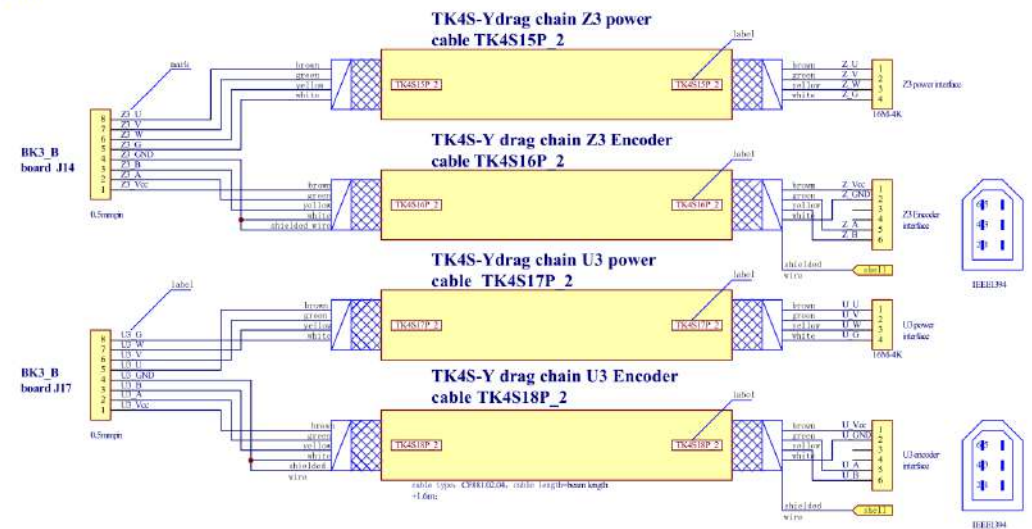

**TK4S-circuit diagram of cutting head3 Y cable V1.0.1**

Details can be found on page 16 and 17 of the 'TK4S machine circuit diagram'